

**PIC32MX3/4 Family Rev. B3 Silicon Errata**

The PIC32MX3/4 devices (Rev. B3) you received conform functionally to the corresponding device data sheet (DS61143D) and family reference manual (DS6113DS80367D2B), except for the anomalies described in this silicon errata document.

Any data sheet or reference manual clarification issues related to the PIC32MX3/4 family would be described in an errata document and made available on the Microchip web site, [www.microchip.com](http://www.microchip.com).

**Silicon errata listed in this document are pertinent exclusively to PIC32MX3/4 family devices with the following Device/Revision IDs:**

Part Number	Device ID	Revision ID
PIC32MX440F256H	0x52	0x409
PIC32MX440F512H	0x56	0x409
PIC32MX440F128H	0x4D	0x409
PIC32MX360F512L	0x38	0x409
PIC32MX360F256L	0x34	0x409
PIC32MX340F128L	0x2D	0x409
PIC32MX320F128L	0x2A	0x409
PIC32MX340F512H	0x16	0x409
PIC32MX340F256H	0x12	0x409
PIC32MX340F128H	0x0D	0x409
PIC32MX320F128H	0x0A	0x409
PIC32MX320F064H	0x06	0x409
PIC32MX320F032H	0x02	0x409

The Device and Revision IDs of a PIC32MX3/4 device can be identified by performing a “Reset and Connect” operation to the device using MPLAB® REAL ICE™ in-circuit emulator with MPLAB IDE, version 8.0 or later.

“Reset and Connect” requires that a device is specified by clicking *Configure>Select Device*. A message that includes the Device ID Revision number of the device is displayed in the **Output** window to indicate successful connection to the device.

A Device ID Revision number acquired by this method can be resolved to the data in the preceding table by splitting the number, as demonstrated by the following example:

“Device ID Revision = 40938000” yields the following IDs:

Device ID = 0x38  
Revision ID = 0x409

# PIC32MX3/4

---

The errata described in this document will be addressed in future revisions of the silicon.

## 1. Module: Device Reset

A Reset ( $\overline{\text{MCLR}}$ ) Pulse that is shorter than 2 SYSCLK will not reset the device properly.

### Work around

Ensure that the device is held in Reset for more than 2 SYSCLK to ensure proper device Reset operation.

## 2. Module: Device Reset

All Resets, except Power-On-Reset (POR), can cause a Fail-Safe Clock Monitor event (if enabled) when the duration of the Reset pulse exceeds the clock period of the internal fail-safe clock reference clock—31 kHz.

### Work around

If long Reset pulses are anticipated, ignore or disable Fail-Safe Clock Monitor events.

## 3. Module: Software Device Reset

Attempting to perform a software device Reset with PBDIV set to 1:1, and SYSCLK less than 1 MHz will not reset the device properly.

### Work arounds

#### **Work around 1:**

Change PBDIV before performing a software Reset.

#### **Work around 2:**

Set SYSCLK to a value that is greater than 1 MHz.

## 4. Module: External Voltage Regulator Mode

A VDDCORE voltage less than 1.75V will cause the CPU to reset when using an external core voltage supply.

### Work arounds

#### **Work around 1:**

Use the internal voltage regulator.

#### **Work around 2:**

Use an external 1.8V regulator which has a regulation specification of  $\leq 2.5\%$ . The Microchip TC1055-1.8VCT713 Low Drop-Out (LDO) regulator, or an equivalent, is recommended.

## 5. Module: ADC

When running the A/D converter in Internal Reference mode, the gain error is 3-4 LSB and the offset error is 1-2 LSB across voltage and speed.

### Work around

Use in-system calibration and software techniques to compensate for these errors.

## 6. Module: Bus Matrix Registers

BMXDUDBA, BMXDUPBA, and BMXPUPBA registers can be set to values that are outside the device's actual memory-size limit.

### Work around

Do not write values greater than the specified memory size of the device to the Bus Matrix registers. Ensure that the upper bits of the registers remain clear ('0').

## 7. Module: Clock Failure Event

After a clock failure event, any write to the OSCCON register erroneously clears the fail-safe condition and attempts to switch to a new clock source that is specified by the NOSC bits in the OSCCON register.

### Work around

After a clock failure event, perform the following steps:

1. Write '000' to the NOSC bits in the OSCCON register to select the Fast RC oscillator. This will ensure that an erroneous clock switch selects the known good on-chip Fast RC oscillator.
2. Modify the OSCCON register with any value your application requires.

## 8. Module: DMA Pattern Match Mode

In Pattern Match mode, the DMA will generate up to 3 additional byte writes to the destination address, after the Pattern Detection event has occurred when performing transfers with the DCHxSSIZ set to greater than 1.

### Work arounds

#### **Work around 1:**

The destination buffer needs to be large enough to accommodate the extra bytes (up to 3 extra bytes).

#### **Work around 2:**

Set the destination size register to 1.

#### **Work around 3:**

Set the source size register to 1.

## 9. Module: Output Compare in PWM Mode

The Output Compare module in PWM mode outputs a high of period register (PRx) length when attempting to use PWM values of 0x00 followed by 0x01.

### Work around

Do not use a PWM value of 0x01.

## 10. Module: Parallel Master Port (PMP)

In PMP Slave 4B Buffer mode, if the underflow Status bit OBF (PMSTAT<6>) is cleared at the same time that a PMP read is attempted, the PMP could get incorrect data.

### Work around

The CPU can read the underflow flag OBUF and set/clear an I/O pin for the external master device to read. The state of the pin should indicate to the external master device that an underflow has occurred and no additional reads should occur until the underflow status has been cleared by the CPU.

## 11. Module: PORTs

When using hardware assisted read-modify-write registers, PORTxINV/PORTxSET/PORTxCLR, the source used for the operation is the LATx register, not the PORTx register. This only affects users who wish to use the pins in a bi-directional mode or wish to store sampled PORTx data in the LATx register.

### Work around

Use a software read-modify-write sequence, such as:

```
//replaces PORTAINV = mask;
x = PORTA ^ mask;
LATA = x;
```

```
//replaces PORTASET = mask;
x = PORTA | mask;
LATA = x;
```

```
//replaces PORTACLAR = mask;
x = PORTA & ~mask;
LATA = x;
```

**Note:** These sequences are not atomic.

## 12. Module: Timer1, 2, 3, 4, 5

The TMRx register stays at zero for two timer clock cycles when the PRx register is 0x0000.

### Work around

None.

## 13. Module: Timer1, 2, 3, 4, 5

The timer prescaler may not be reset correctly when it is used with a slow external clock. This can occur when the timer is disabled and then re-enabled. The result could be a spurious count in the prescaler.

### Work around

To ensure a reset of the prescaler, firmware must wait for at least 2 input clock periods before re-enabling the timer.

## 14. Module: Timer1 in Asynchronous Mode

The Timer1 prescaler may not be reset correctly when it is used with a slow external clock. This can occur when the timer is disabled and then re-enabled. The result could be a spurious count in the prescaler.

### Work around

None.

## 15. Module: UART Hardware Handshake Mode

The CTS pin does not deassert until at least 2 bytes are free in the UART FIFO.

### Work around

The UART TXREG must be read at least 2 times to rearm the hardware handshaking lines.

## 16. Module: Watchdog Timer (WDT)

An incorrect WDT time-out Reset may occur when both of these conditions are present:

1. WDT is enabled.
2. Either a MCLR (EXTR) or Software Reset (SWR) occurs just before WDT is about to expire.

### Work around

To detect incorrect WDT time-out Reset, always confirm that only the WDTO bit is set in RCON register. If EXTR, SWR, or any other Reset bits are set, it indicates that an incorrect WDT has occurred.

## 17. Module: DMA Channel Abort

DMA channel abort on a channel that is not currently active may have unintended effects on other active channels.

### Work around

1. Suspend the channel, rather than abort, by clearing the channel enable bit DCHxCON<CHEN>.
2. Wait until other DMA channels complete before issuing the abort.

## 18. Module: Oscillator

The Primary Oscillator Circuit (POSC), when using XT/XTPLL/HS/HSPLL modes, does not operate over the voltage and temperature range that is listed as item D5 in the device data sheet. The operation range without the work around is limited to -40°C through +70°C when V<sub>DD</sub> < 3.0V.

### Work around

Install a 4.1 MΩ resistor in parallel with the crystal. This allows operation across the temperature range that is listed in the data sheet.

## 19. Module: Parallel Master Port (PMP)

The WAITE field in PMMODE<1:0> does not add a Wait state to PMP master reads when it is programmed to the value '01'. The WAITE field allows Wait states to be added to the end of PMP read/write operations. This field is intended to add the following Wait clocks after the read operation completes:

- 00 – no Wait states
- 01 – 1 Wait state
- 10 – 2 Wait states
- 11 – 3 Wait states

Current behavior is the following:

- 00 – no Wait states
- 01 – no Wait states
- 10 – 2 Wait states
- 11 – 3 Wait states

### Work around

This erratum only applies to PMP master read operations. PMP writes work correctly. Use another wait state control value that is allowed for the attached device.

## 20. Module: UART Baud Rate Generator

Using BRG values of 0, 1, or 2 cause the Start bit to be shortened. This results in errors when receiving the data. This issue exists for BRGH values of '0' and '1'.

### Work around

Do not use BRG values of 0, 1, or 2. Select system and peripheral bus clocks' frequencies such that the BRG value for the desired baud rate generator value is greater than 2.

## 21. Module: Input Capture with DMA in 16-Bit Mode

16-bit DMA transfers from the ICAP module FIFO buffer do not advance the ICAP FIFO pointer. This results in the entire DMA output buffer being filled with the first value from the ICAP FIFO.

### Work around

Configure the DMA to perform 32-bit transfers from the ICAP FIFO.

## 22. Module: USB

The D plus and D minus pins are not 5V tolerant. During normal operation these pins are not subject to 5V. The 5V tolerance specification is intended to prevent device damage in an abnormal operation mode such as connecting a shorted USB cable to the device.

### Work around

Do not subject D plus or D minus to 5V.

## 23. Module: USB Module Cannot Communicate in Host Mode with a Low-Speed Device Connected Through a Hub

The USB module does not correctly switch from full speed to low speed after sending a PRE packet to a hub.

### Work around

Connect a low-speed device directly to the PIC32.

## 24. Module: Breakpoints While Using DMA

The DMA buffer may be erroneously filled with the last data read prior to the breakpoint. This buffer fill will continue until the DMA buffer is full.

However, the DMA buffer fills correctly if those same peripherals are used as DMA destinations, even when the CPU goes into Debug Exception mode.

This behavior occurs when the DMA controller is actively transferring data and a debugger hits a breakpoint, causes a single-step operation, or halts the target. See Table 1.

The following table lists the peripherals and input registers that could affect DMA buffer usage.

**TABLE 1: REGISTERS AND PERIPHERALS AFFECTED BY BREAKPOINTS DURING DMA TRANSFERS**

Peripheral as DMA Source	Transfer from Input Register
Change Notice	PORTx
SPI	SPIxBUF
PMP	PMDIN
UART	UxRXREG
Input Capture	ICxBUF

### Work around

If the debugger halts during a DMA transfer from one of these registers, either ignore the DMA transferred data or restart the debug session.

## 25. Module: Using PMP as DMA source

Events can be missed if the PMDIN register is used as the DMA source and the PMP IRQ is used as the DMA trigger.

### Work around

Do not use DMA for PMP read operations. DMA can be used for PMP write operations with the PMDIN register as the DMA destination.

## 26. Module: USB Single-Ended Comparator Trip Point Violates USB Specification

The single-ended comparator used to detect SE0 transitions at a voltage higher than the USB specification. This is a compliance issue relating to items ST2 and ST3 in the Peripheral Silicon checklist. This may result in reduced noise immunity.

### Work around

None.

## 27. Module: Input Capture

When in 16-bit mode, the upper 16 bits of the 32-bit ICxBUF register contain Timer3 values.

### Work around

Mask the upper 16 bits of the read value.

Example: result = 0xFFFF & IC1BUF

## 28. Module: 2-Wire Programming

When programming the PIC32 using the 2-wire PGC and PGD pins, programming data appears as an output on the JTAG TDO pin.

### Work around

Do not connect the TDO pin to a device that would be adversely affected by rapid pin toggling during programming.

## 29. Module: UART

In BRGH=1 mode the received data is not sampled in the middle of the bit. This reduces the UART's baud rate mismatch tolerance.

### Work around

Use BRGH=0 mode.

## 30. Module: Oscillator Clock Out

A clock signal is present on the CLKO pin regardless of the clock source and setting of the CLOCKOUT Configuration bit under any of the following conditions.

1. During a Power-On-Reset (POR).
2. During device programming.
3. After a JTAG erase. A clock is present on the CLKO pin until the Configuration bit to disable CLOCKOUT is programmed.

### Work around

Do not connect the CLKO pin to a device that would be adversely affected by rapid pin toggling or a frequency other than that defined by the oscillator configuration. Do not use the CLKO pin as an input if the device connected to the CLKO pin would be adversely affected by the pin driving a signal out.

## 31. Module: ADC

Enabling the primary programming/debug port (PGC1/PGD1) on 64 lead variants disables the external and internal references for the ADC, making the ADC unusable.

### Work around

Use the secondary programming/debug port.

# PIC32MX3/4

---

## APPENDIX A: REVISION HISTORY

### Revision A (02/2008)

Initial release of this document.

### Revision B (04/2008)

Oscillator temperature issue was added. Flash Program Memory 500ns delay requirement is now classified as architectural behavior. Added PMP WAITE behavior.

### Revision C (10/2008)

Modified errata item 11 PORTs. Added errata items 20 UART module, 21 Input Capture module, 22 USB module, 23 USB module, 24 Breakpoints, 25 Parallel Master Port module, 26 Parallel Master Port module, 27 USB module, 28 Input Capture module and 29 2-Wire Programming.

### Revision D (12/2008)

Added the following modules:

**“Item 27. Module: UART”**

**“Item 28. Module: Oscillator Clock Out”**

**“Item 2. Module: ADC”**

Revised **“Item 13. Timer1, 2, 3, 4, 5”**

---

**Note the following details of the code protection feature on Microchip devices:**

- Microchip products meet the specification contained in their particular Microchip Data Sheet.
- Microchip believes that its family of products is one of the most secure families of its kind on the market today, when used in the intended manner and under normal conditions.
- There are dishonest and possibly illegal methods used to breach the code protection feature. All of these methods, to our knowledge, require using the Microchip products in a manner outside the operating specifications contained in Microchip's Data Sheets. Most likely, the person doing so is engaged in theft of intellectual property.
- Microchip is willing to work with the customer who is concerned about the integrity of their code.
- Neither Microchip nor any other semiconductor manufacturer can guarantee the security of their code. Code protection does not mean that we are guaranteeing the product as “unbreakable.”

Code protection is constantly evolving. We at Microchip are committed to continuously improving the code protection features of our products. Attempts to break Microchip's code protection feature may be a violation of the Digital Millennium Copyright Act. If such acts allow unauthorized access to your software or other copyrighted work, you may have a right to sue for relief under that Act.

---

Information contained in this publication regarding device applications and the like is provided only for your convenience and may be superseded by updates. It is your responsibility to ensure that your application meets with your specifications. MICROCHIP MAKES NO REPRESENTATIONS OR WARRANTIES OF ANY KIND WHETHER EXPRESS OR IMPLIED, WRITTEN OR ORAL, STATUTORY OR OTHERWISE, RELATED TO THE INFORMATION, INCLUDING BUT NOT LIMITED TO ITS CONDITION, QUALITY, PERFORMANCE, MERCHANTABILITY OR FITNESS FOR PURPOSE. Microchip disclaims all liability arising from this information and its use. Use of Microchip devices in life support and/or safety applications is entirely at the buyer's risk, and the buyer agrees to defend, indemnify and hold harmless Microchip from any and all damages, claims, suits, or expenses resulting from such use. No licenses are conveyed, implicitly or otherwise, under any Microchip intellectual property rights.

**Trademarks**

The Microchip name and logo, the Microchip logo, Accuron, dsPIC, KEELOQ, KEELOQ logo, MPLAB, PIC, PICmicro, PICSTART, rfPIC, SmartShunt and UNI/O are registered trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

FilterLab, Linear Active Thermistor, MXDEV, MXLAB, SEEVAL, SmartSensor and The Embedded Control Solutions Company are registered trademarks of Microchip Technology Incorporated in the U.S.A.

Analog-for-the-Digital Age, Application Maestro, CodeGuard, dsPICDEM, dsPICDEM.net, dsPICworks, dsSPEAK, ECAN, ECONOMONITOR, FanSense, In-Circuit Serial Programming, ICSP, ICEPIC, Mindi, MiWi, MPASM, MPLAB Certified logo, MPLIB, MPLINK, mTouch, PICkit, PICDEM, PICDEM.net, PICtail, PIC<sup>32</sup> logo, PowerCal, PowerInfo, PowerMate, PowerTool, REAL ICE, rfLAB, Select Mode, Total Endurance, WiperLock and ZENA are trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

SQTP is a service mark of Microchip Technology Incorporated in the U.S.A.

All other trademarks mentioned herein are property of their respective companies.

© 2008, Microchip Technology Incorporated, Printed in the U.S.A., All Rights Reserved.

 Printed on recycled paper.

**QUALITY MANAGEMENT SYSTEM  
CERTIFIED BY DNV  
== ISO/TS 16949:2002 ==**

*Microchip received ISO/TS-16949:2002 certification for its worldwide headquarters, design and wafer fabrication facilities in Chandler and Tempe, Arizona; Gresham, Oregon and design centers in California and India. The Company's quality system processes and procedures are for its PIC® MCUs and dsPIC® DSCs, KEELOQ® code hopping devices, Serial EEPROMs, microperipherals, nonvolatile memory and analog products. In addition, Microchip's quality system for the design and manufacture of development systems is ISO 9001:2000 certified.*



## WORLDWIDE SALES AND SERVICE

### AMERICAS

**Corporate Office**  
2355 West Chandler Blvd.  
Chandler, AZ 85224-6199  
Tel: 480-792-7200  
Fax: 480-792-7277  
Technical Support:  
<http://support.microchip.com>  
Web Address:  
[www.microchip.com](http://www.microchip.com)

**Atlanta**  
Duluth, GA  
Tel: 678-957-9614  
Fax: 678-957-1455

**Boston**  
Westborough, MA  
Tel: 774-760-0087  
Fax: 774-760-0088

**Chicago**  
Itasca, IL  
Tel: 630-285-0071  
Fax: 630-285-0075

**Dallas**  
Addison, TX  
Tel: 972-818-7423  
Fax: 972-818-2924

**Detroit**  
Farmington Hills, MI  
Tel: 248-538-2250  
Fax: 248-538-2260

**Kokomo**  
Kokomo, IN  
Tel: 765-864-8360  
Fax: 765-864-8387

**Los Angeles**  
Mission Viejo, CA  
Tel: 949-462-9523  
Fax: 949-462-9608

**Santa Clara**  
Santa Clara, CA  
Tel: 408-961-6444  
Fax: 408-961-6445

**Toronto**  
Mississauga, Ontario,  
Canada  
Tel: 905-673-0699  
Fax: 905-673-6509

### ASIA/PACIFIC

**Asia Pacific Office**  
Suites 3707-14, 37th Floor  
Tower 6, The Gateway  
Harbour City, Kowloon  
Hong Kong  
Tel: 852-2401-1200  
Fax: 852-2401-3431

**Australia - Sydney**  
Tel: 61-2-9868-6733  
Fax: 61-2-9868-6755

**China - Beijing**  
Tel: 86-10-8528-2100  
Fax: 86-10-8528-2104

**China - Chengdu**  
Tel: 86-28-8665-5511  
Fax: 86-28-8665-7889

**China - Hong Kong SAR**  
Tel: 852-2401-1200  
Fax: 852-2401-3431

**China - Nanjing**  
Tel: 86-25-8473-2460  
Fax: 86-25-8473-2470

**China - Qingdao**  
Tel: 86-532-8502-7355  
Fax: 86-532-8502-7205

**China - Shanghai**  
Tel: 86-21-5407-5533  
Fax: 86-21-5407-5066

**China - Shenyang**  
Tel: 86-24-2334-2829  
Fax: 86-24-2334-2393

**China - Shenzhen**  
Tel: 86-755-8203-2660  
Fax: 86-755-8203-1760

**China - Wuhan**  
Tel: 86-27-5980-5300  
Fax: 86-27-5980-5118

**China - Xiamen**  
Tel: 86-592-2388138  
Fax: 86-592-2388130

**China - Xian**  
Tel: 86-29-8833-7252  
Fax: 86-29-8833-7256

**China - Zhuhai**  
Tel: 86-756-3210040  
Fax: 86-756-3210049

### ASIA/PACIFIC

**India - Bangalore**  
Tel: 91-80-4182-8400  
Fax: 91-80-4182-8422

**India - New Delhi**  
Tel: 91-11-4160-8631  
Fax: 91-11-4160-8632

**India - Pune**  
Tel: 91-20-2566-1512  
Fax: 91-20-2566-1513

**Japan - Yokohama**  
Tel: 81-45-471- 6166  
Fax: 81-45-471-6122

**Korea - Daegu**  
Tel: 82-53-744-4301  
Fax: 82-53-744-4302

**Korea - Seoul**  
Tel: 82-2-554-7200  
Fax: 82-2-558-5932 or  
82-2-558-5934

**Malaysia - Kuala Lumpur**  
Tel: 60-3-6201-9857  
Fax: 60-3-6201-9859

**Malaysia - Penang**  
Tel: 60-4-227-8870  
Fax: 60-4-227-4068

**Philippines - Manila**  
Tel: 63-2-634-9065  
Fax: 63-2-634-9069

**Singapore**  
Tel: 65-6334-8870  
Fax: 65-6334-8850

**Taiwan - Hsin Chu**  
Tel: 886-3-572-9526  
Fax: 886-3-572-6459

**Taiwan - Kaohsiung**  
Tel: 886-7-536-4818  
Fax: 886-7-536-4803

**Taiwan - Taipei**  
Tel: 886-2-2500-6610  
Fax: 886-2-2508-0102

**Thailand - Bangkok**  
Tel: 66-2-694-1351  
Fax: 66-2-694-1350

### EUROPE

**Austria - Wels**  
Tel: 43-7242-2244-39  
Fax: 43-7242-2244-393

**Denmark - Copenhagen**  
Tel: 45-4450-2828  
Fax: 45-4485-2829

**France - Paris**  
Tel: 33-1-69-53-63-20  
Fax: 33-1-69-30-90-79

**Germany - Munich**  
Tel: 49-89-627-144-0  
Fax: 49-89-627-144-44

**Italy - Milan**  
Tel: 39-0331-742611  
Fax: 39-0331-466781

**Netherlands - Drunen**  
Tel: 31-416-690399  
Fax: 31-416-690340

**Spain - Madrid**  
Tel: 34-91-708-08-90  
Fax: 34-91-708-08-91

**UK - Wokingham**  
Tel: 44-118-921-5869  
Fax: 44-118-921-5820